



Anstatt dem O-Ring kommt jetzt auch beim „normalen EVN“ die neue Dichtung, sie ist lamellenartig und hat auch bessere Funktion bei Staubpartikel zwischen Ventilplatte und Dichtung. Es gibt sie in EPDM und Silikon.

- Max. Prozesstemperatur 120°C bei EPDM Dichtung
- Max. Prozesstemperatur 180°C bei SILIKON Dichtung
 - Umgebungstemperatur -20°C bis 80°C

ALT:

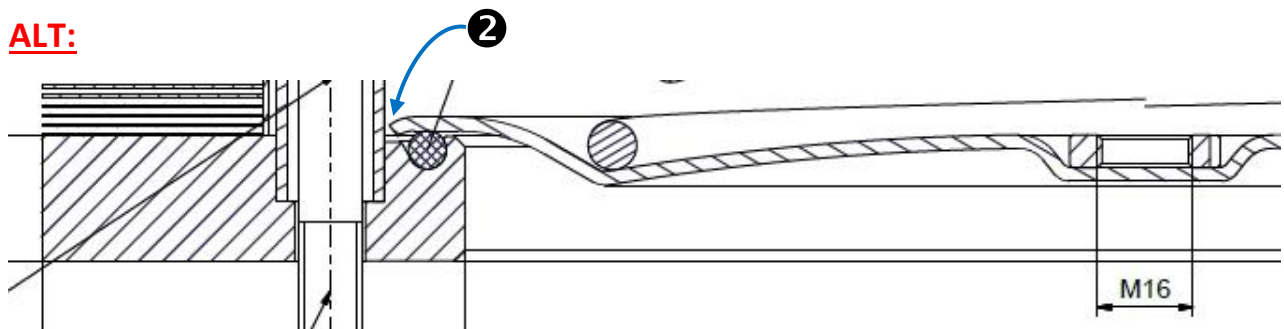


NEU:

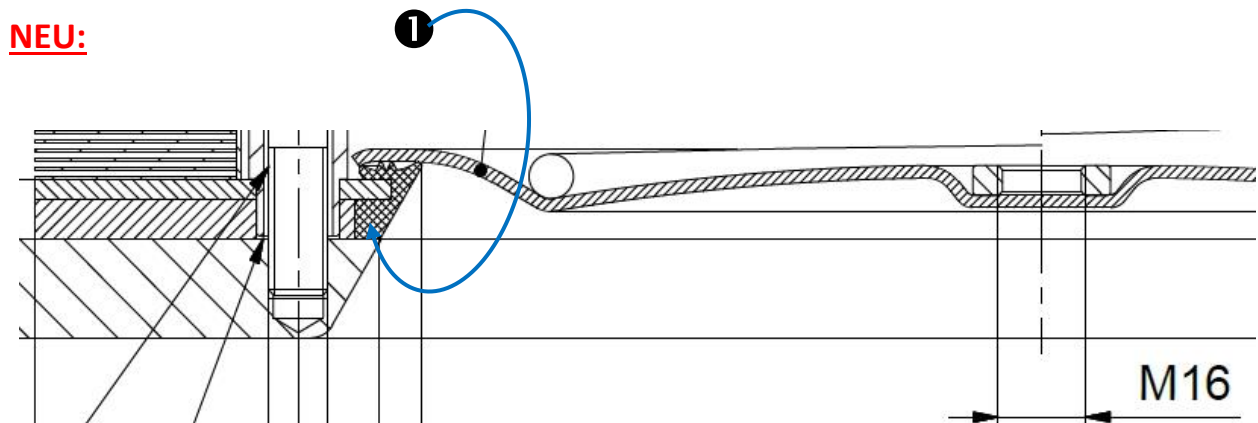

Die neue Dichtung reicht bis zum Ventilflansch, der Kunde benötigt daher keine zusätzliche Dichtung bei der Befestigung an seiner Anlage (Silo, Filter, ...) ❶

Die neue Dichtung umschließt den Ventilsitz, das Staubmedium/das Produkt kommt daher nur mehr mit dem Ventilteller in Berührung, nicht mehr mit dem Ventilsitz ❷

Für Kunden, die EVN2.0 bereits verwenden und ggf. auf EVN3.0 wechseln, ist der Flanschinnendurchmesser größer als beim EVN2.0. Das heißt, wenn die kundenseitige Konstruktion nicht auf den InnenØ vom 3.0 angepasst wird, hat der Kunde hier einen Rücksprung und ein potenzielles Hygieneproblem. Daher bitte die bestehenden Kunden entsprechend informieren. ❸

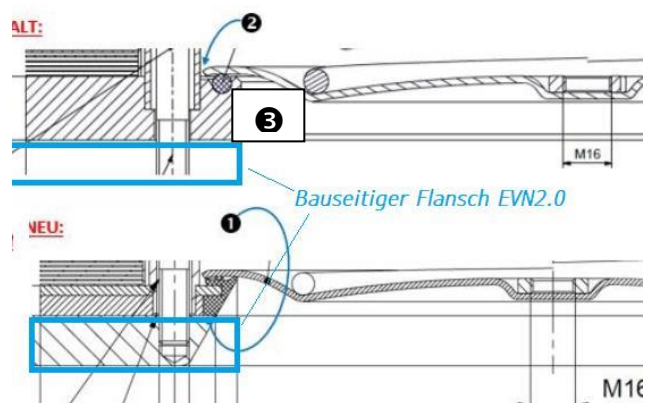


Difference „old“ 2.0EVN and 3.0EVN (266-735):


Instead of the O-ring, the "normal EVN" now has the new seal, it is lamellar and also has a better function with dust particles between the valve plate and the seal. They are available in EPDM and silicone.

- Max. process temperature 120°C with EPDM seal
- Max. process temperature 180°C with SILIKON seal
 - atmosphere temperature -20°C to 80°C

„OLD“:

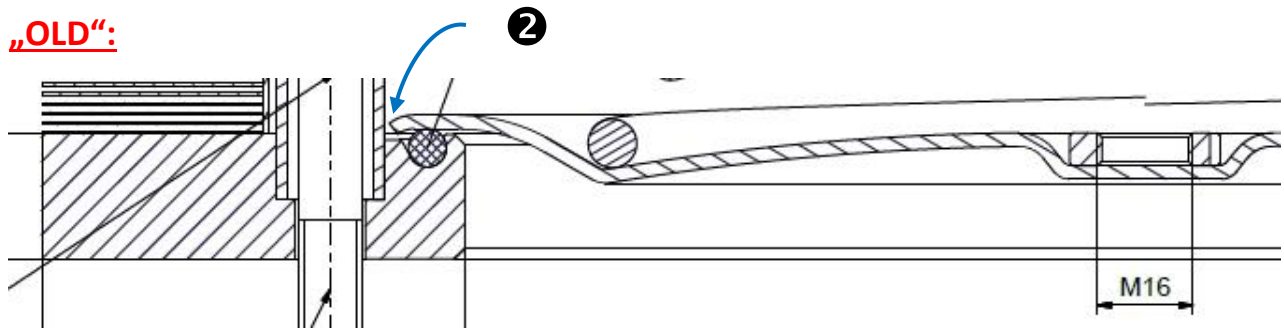

NEW:

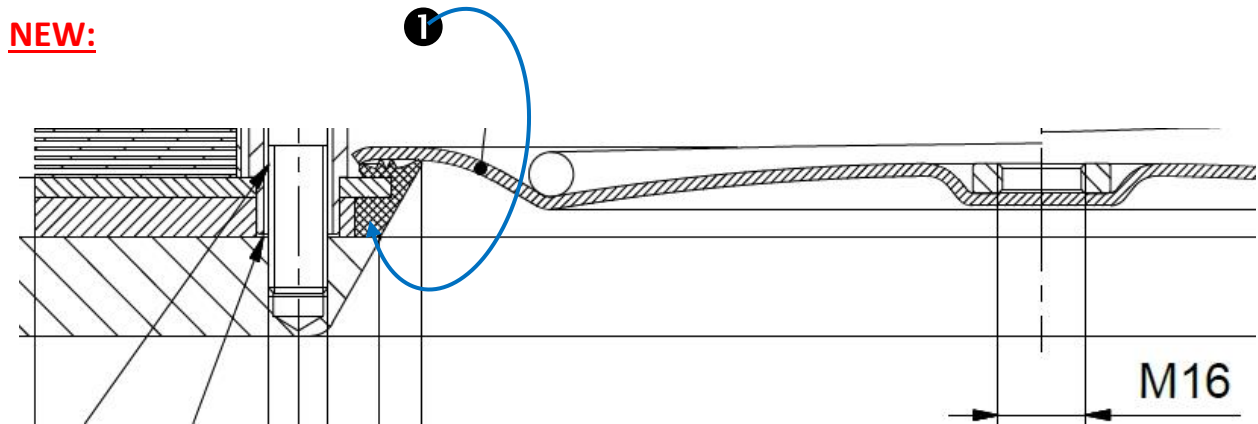

The new seal extends to the valve flange, so the customer does not need an additional seal when attaching it to his system (silo, filter, ...) ❶

The new seal encloses the valve seat, so the dust medium/the product only comes in to contact with the valve plate and no longer with the valve seat ❷

For customers, who are already using EVN2.0 and may be switching to EVN3.0, the inner diameter of the flange is larger than that of the EVN2.0!

This means that if the customer's construction is not adapted to the inner diameter of 3.0, the customer has a setback and a potential hygiene problem. Therefore, please inform existing customers ❸

